

WAAS CH 70518 W35A	APP CRS 350°	Rwy Idg TDZE 1135 Apt Elev 1137
--	------------------------	---

RNAV (GPS) RWY 35

HAMILTON MUNI (VGC)

RNP APCH.


▼

▲ NA

Baro-VNAV and VDP NA when using Syracuse altimeter setting. Rwy 35 helicopter visibility reduction below $\frac{3}{4}$ SM NA. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -17°C or above 50°C. When local altimeter setting not received, use Syracuse altimeter setting and increase LPV DA to 1748, LNAV/VNAV DA to 2164 and all MDA 180 feet; increase LPV visibility to $1\frac{3}{4}$ SM and LNAV Cat A/B visibility to $1\frac{1}{2}$ SM and Cat C visibility to $2\frac{1}{2}$ SM.

MISSED APPROACH: Climb to 3500 direct KREMM and hold.

AWOS-3P 119.425	SYRACUSE APP CON 126.125 269.125	UNICOM 123.0 (CTAF)	122.7
---------------------------	--	-------------------------------	--------------

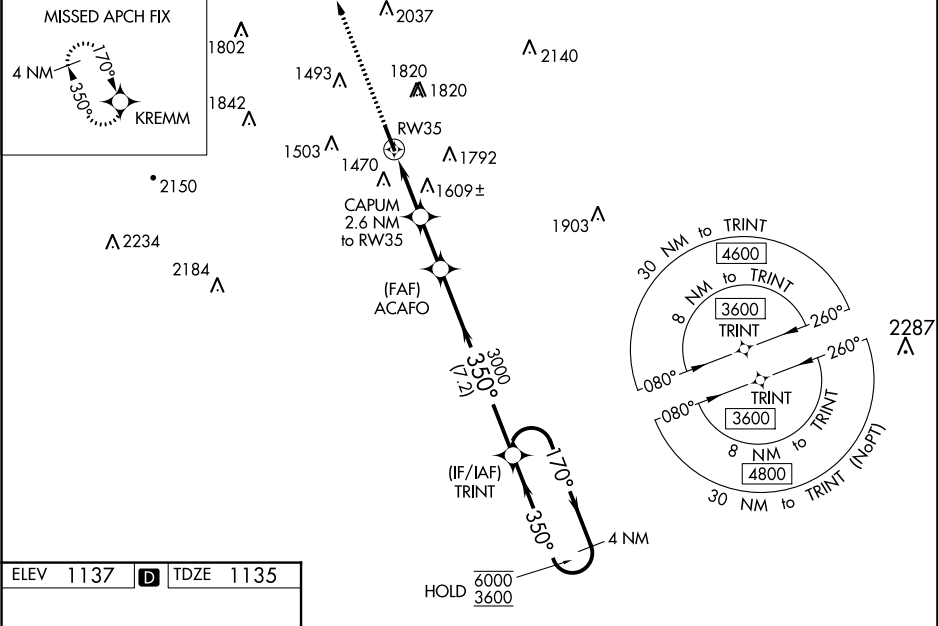

3500 KREMM	VGSI and RNAV glidepath not coincident (VGSI Angle 4.00/TCH 40).			4 NM TRINT Holding Pattern
	ACAFO 3000			170° 6000 ← 350° 3600
* LNAV only	CAPUM 2.6 NM to RW35			GP 3.77° TCH 40
RW35	* 1.6 NM to RW35			
	ACAFO 3000			
1.6 NM	1 NM			7.2 NM
CATEGORY	A	B	C	D
LPV DA	1581-1 $\frac{3}{8}$ 446 (500-1 $\frac{3}{8}$)			NA
LNAV/VNAV DA	1997-4 862 (900-4)			NA
LNAV MDA	1860-1	725 (800-1)	1860-2 725 (800-2)	NA
CIRCLING	2040-1 $\frac{1}{4}$ 903 (1000-1 $\frac{1}{4}$)	2120-1 $\frac{1}{2}$ 983 (1000-1 $\frac{1}{2}$)	2340-3 1203 (1300-3)	NA